


Pri

T

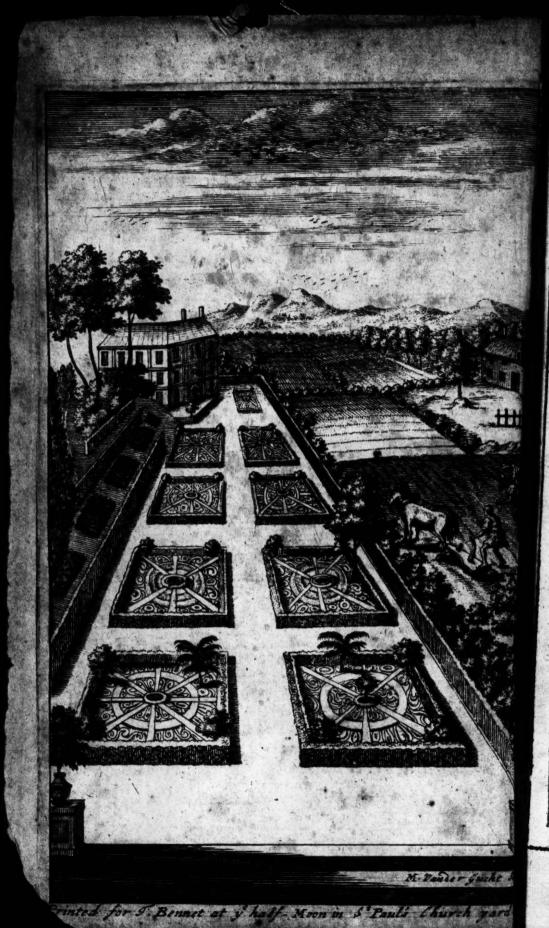

Pri

T

The Mistery of Husbandry discover'd.

Several New and Advantageous ways

Tillage, Sowing, Planting, Manurcing and Improving Of all forts of

Meadows, Pasture, Corn - Land, Woods Gardens, Orchards.

A S

Also of Fruit for Cyder and Perry, and of Clover St. Foin, and other new Hays; with the Means to Preserve Husbandry in good Order, consider'd in these Particulars: First, The Office of a Country Justice, and other Inserior Officers. Secondly, Of Inns and Ale-Houses, there use and abuse. Thirdly, On Servants and Labourers. Fourthly, On the Poor. A Country House described, both as to Scituation, Building, Courts, Gardens, Orchards, Eish-Ponds, Out-Houses, Barns, Stables, dsc. With an Essay on Fuel and Wood-Fires.

By Tim. Nourse, Gent.

The Third Edition. To which is added, The Compleat Collier: or, An Account how to find and work Coal, and Coal-Mines, the like never before Printed. By J. C.

LONDON:

Printed for George Conyers, at the Ring in Little Britain, 1708.

THE

Compleat Collier:

Or, The whole

ART

Sinking, Getting, and Working, Coal-Mines, &c.

A S

whe

and j

Adv

Uc. Tho

gars, alfo

fuch

Coll

I sha follo

lieny

you

Is now used in the Northern Parts, Especially about

SUNDERLAND

AND

New-Castle.

By 7. C.

Et thus & vividum Ignem in Carbonibus Prudent.

London: Printed for G. Conyers at the Ring in Little-Brittain. 1708. Pr. 66.



THE

Compleat Collierie, &c.

OLLIERIES, or the Coal Trade being of fo great Advantage to the Crown and Kingdom, I have thought fit to publish this short Treatise thereof, (having not met with Books of that Nature hitherto,) in order to encourage Gentlemen, (or fuch) who have Estates or Lands wherein Coal Mines are wrought or may be won, to carry on for useful and beneficial an Imployment, as this is, which I need not mention the Particulars of, both in respect of Fires, for private and publick use; as also in respect of the Revenue it brings in Yearly, or in Respect of the great And to build St. Advantage it is, being a Nursery for Saylers, Paul's. &c. or laftly, in respect of its imploying so many Thousands of the poor in those Northern parts of England, which are maintained by it, who must otherwise of Course be Beggars, or would be starved, if Coal Mines were not carried on; as also explain the whole Art of Collery, that Coal-Owners, (or fuch who have or may work their Colleries) may of themselves by this Book know better how to carry on fuch an Undertaking. and that they may not be too much imposed on by their head Servants, or such who imploy the poor Labourers or Miners in their Colleries; by keeping the Owners in Ignorance of the Work and Charge; therefore in order to proceed on these several Heads, I shall begin (and with as much Brevity as I can) after this plain following Method.

Coal-Owner.] Friend, you tell me you have hopes to win a Col-

liery in my Grounds, pray tell me your Reasons for it?

Servant, or Undertaker.] Sir, my Reasons are as follow: In the first place your Ground Borders on other Collectes, which are working Collectes, which makes it plain that there is Coal so near you; but more especially, you may please to observe in your B Grounds.

Signs of a Colliery.

Camb. Brittain.

Boreing an

Assuarance of

Grounds, the Undoubted Tokens or Signs of a Collery, which are these following: First, there is an Out-burst or an appearance above Ground, of some Vein of Coal, which some History Writers says, was the first Encouragement to begin

W

ma

the

to

ha

up

mo

N

of

no

Fee

the

Wal Ho be l

fo is place Fed

ing

Wa

fink

latti

a E

to h

Co

Sinl

bor

and

our

is at

beer

Ove

the

raife. Fee

Coal-Work: Or, Secondly, you have an Out-burst or appearance of such Stone (as we call Coal-Stone) but if these Signs do not satisfy you throwly: We have in the last place this undeni-

able Proof and Affurance by boreing the Grounds with proper Instruments whereby we can discover the Nature of the Earth, Minerals, and Water, that may be met with in our way

Sinking, nay we can thereby discover to a small Matter how deep your Coal lies in the Earth, and what thickness the Coal-bed is of.

Owner.] Pray Name me your boreing Instruments, and let me know their use.

The way of Boreing.

Servant. We have two Labourers at a time, at the handle of the bore Rod, and they chop, or pounce with their Hands up and down to cut the Stone or Mineral, going round, which of course grinds either of them small, so that finding your Rod to have cut down four or fix Inches, they lift up the Rod, either all at once, as there is conveniency for its Lift; or by Joynts, fixing the Key, which is to keep the Rod from droping down into the hole, and fo sometimes looses the Rod, or at least, occasions a great loss of time to get it up again, and taking off the cutting Chiffel, puts, or screws on the Wimble or Scoop which takes up the cut Stuff be it what happens; and so by fight of the Stuff taken out of the Wimble, or Scoop, you plainly discover of what Kind it is, which we fo cut or grind, and fo confequently what follows to any depth; for by Addition of Joynts, (which we krew into the Rod, we can descend to any depth; as also by knowing the length of the Rod to fuch and fuch fort of Stone and Coal, &c. we have the certainty of what depth the Coal lies, and likewise thereby may know to an Inch the thickness of the Bed, or Vein, of Coal, befides, (which I need not mention)

Boreing useful. or where we prick'd the Water Feeders, and (what is farther useful and requisite in Collyries) we can hereby find whether we are finking upon an old wast (or wrought Collery) which saves a great deal of Moneys in finking, so deep as 30, 40 or 60 Fathom to no purpose, for you



will not be at above 15 or 20 s. per Fathom Boreing, when perhaps it may cost 50 s. or 3 l. per Fathom to sink at least, nay, many times a great deal more, especially if a Whin (which is the hardest fort of Stone, met with in the Earth) lye in the way to be cut through, which I have known so hard, that the hardest temper'd Steel we could prepare, would scarce work upon, and that the said Whin of two Yards Diameter, and little more than 23 Inches thick has stood in near 20 l. cost. But, Note, that about 3 Inches Diameter for a Bore-hole (or Boreing) is sufficient.

Coal-Owner.] Well, I think you have pretty well fatisfy'd me of the Method, Benefit, and Charge of Boreing, but do you

not use Boreing sometime in (or with) Sinking?

of a

there

und,

Wri-

pegin

ear-

is do

deni-

ounds

rals,

way

to a

what

t me

the

n to

inds

nwo

, as

Cey,

and

s of

uts,

tuff

of

ind

hat

we

by

and

ics,

the

n)

ry,

nd

ly-

old

in

ill

di-

Servant. Yes, Sir, very often, for if we meet with a great Feeder of Water in Sinking a Pit in a working Collery; to fave the Trouble and Charge of Sinking with that Feeder to the Coal, for it were Folly and unreasonable Charge, besides a valt loss of time to, to Lave, or fill 20 or 30 Tubs of Water per Hour, of 30 Gallons a piece, which Water by a Bore-hole may be let down into the Collery, where we defign to hole our Pit, and fois by a Drifter Water-course from the old Pits, set away to the place where your Collery Water is all drawn, therefore such Feder so running down such bore-hole, saves its Charge of Boreing in Sinking, by preventing the coft and loss of time in Laving, the Water or Feeder, that would otherwise be drawn up as they work or link the Shaft, as is the dayly Practice of these Northern Parts. And lattly, it is a very good Caution, even in a Coaled Pit, to put down a Bore-Rod about a Fathom, for a Sump (or Well to a Coal-Pit) to hold the Drawings) or silings as we call them there) of Water, whether Rain or otherwise, least in that little depth, after a Pit is Coaled, we should raise a Feeder which would be a great Charge on the Collery to draw, nay fometimes has drowned a Collery by Sinking it rashly, which might have been prevented by a Fathom boreing in the Thill or Bottom under the Coal you would Work; and you may have Boreing undertaken by the great, or otherwise our Sinking Labourers, with a careful Observant Over Man's Advice and Inspection, will perform it for finking Wages, which is about 12 d. or 14 d. per Day.

Coal Owners Object.] But I have heard of Colleries which have

been drowned by Boreing, what fay you to that?

Servants Answer.] That sure has been for want of Care in the Over-Man Imployed, for we should always be watchful, and have good strong wooden Plugs ready made, whilst boreing, to chop into the Bore-hole immediately if a strong Feeder shou'd chance to be raised of a suddain, which Pluging will stop any Bore-hole Feeder I dare affirm; if that Vigilency be observed duly,

Coal Owner.] Well, let me hear now what you fay to finking a Coal-Pit, what Utenfils are requisite? and the Method you pro-

wh

Co

Bu

ces

80

ind

yo

tor

Fir

OV

fre

ad

to

th

m

ft

of

gi

C

is tl

th

n

b

C

b

pose in Sinking.

Servant.) First, to Sink a Pit, we must have a stock of Timber prepared, that is to say, we must have either Oaken Spars, or First bawks, which is most used (being cheapest in these parts) for Pit Bars, and a quantity of deal Boards to be wedged in between the Bars and the Earth, to keep the Earth, or some times soft Mettle, or Minerals, (as we meet with it,) from falling into the Pit, and filling up our sinking, with a good Quantity of Nails, likewise the Pick-Ax and Shovel to break up the Soil or Surface of the Earth, we are to dig till we sink down to the Stone head, so that the said Pit-Bars of Wood and Deals must be used till we get to the Stone, and in some places it may be 8 or 10 Fathom of Earth to the Stone Head and more, and in other places but a small matter, so that the Provision for such things is proportioned to the depth as needful.

And now I shall make bold to recite to you Observations. something, which in my Experience of Sinking I have Observed, that after we get down to the Stone Head, there being Mould, Sand, Gravil or Clay (all which I call Earth) till we come to the Stone, we never meet with any more Earth again, let us descend to what depth we can, but find it all some fort of Stone (or Rock) or Menerals, and Vains (or Beds) of several forts of Coal, for you must Note, we have several Coals in some Colleries before we get the Main-Coal,

which is generally most esteemed.

There is in some Colleries 7 or 8 sorts of Coal, There are the Pipe-Coal, Names and which perhaps forts of Coals. not above 4 or fix Inches thick. The Crow-Coal about a Foot or less thick. The 3 Quarter Coal about 3 Quartes thick or more, all which are foul or bad Coals, and not worth much, tho' I have known the 3 Quarter Coals used in making Salt, and believe it is so yet at Shields or elsewhere, but, I think the best Coals are best for the Salt Pans and Salt too, and make most and best Salt, if they could afford a Price, as no doubt they may, for helt Coals, as some Salt-makers have confest. And there is the half Yard Cole, which is so called, it being of about that thickness, but is generally good Coal, and better then the 3 Quarter Coal, yet being so low to work in, or but of that small Thickness) it is scarce worth while to work it, there is also the five Quarter Coal, which is of about that thickness of 5 Quarters, and that is in some Colleries very fine, and makes a hot quick Fire, but doth not Cement or Cake well, yet I have known it make excellent Fires for any fort of use, but not so lasting as the Main-Coal is in general: I am told there is at a place colled Cullercoats, or Blyth Nook, a Coal much of the Nature of this 5 Quarter Coal, which

ing a promber Fire r Pit n the ttle, and wife the that the arth mall oned you king

any but ains we oal,

to hich

is coal coal sals, ifed in I

e 3 nall ive

ere

or al,

re,

which I have above described, and have heard that these & Quarter Coals, mix'd with Main Coal, give Satisfaction in their Use or Burning: But there is also the Main-Coal, which is in some Places thicker then others, sometimes you have it 7 Quarters, sometimes 8 Quarters, and fometimes 8 Quarters and half thick, any of which indeed is thick enough and valluable; this is the Coal I would wish you to have, this is the thing I think may please all People for Use, for this in these Northern Parts is generally best, both for a good Fire, and a lasting Fire. You may make a Fire of this 2 or 3 times over, for turn it over after it is Caked, it will again burn brisk and fresh as at first, but its Excellency is so generally known, that I need add no more on this Head, only by the By I think I may venture to fay, It is not fo much valued as it ought to be at this time, especially at the Pits, for was it ever heard of, or known that this Noble. this Main-Coale, was fold, as lately it was, or now is, for 8's. per Chaldron, Water, or New-Castle or Sunderland Measure, which (you must Note) is generally reckoned double the Measure of a London Chaldron, or more? This I think is shameful for Owners, who striving to get all the Trade to themselves, or to have a Major Part of Vend, will fall out among themselves, and as it were almost give or throw away fo valuable and Indispencibly necessary a Mineral and Servant as this is, Not that I speak this to raise the Price of Coals on the poor, or others about London, or other parts where it is lo much used, and especially in these times, when Taxes or other things may be more now, than at other times; No, for I fear they have not the Benefit of the lowness of Price as at the Pits; but I fear others have the Benefit of it, who less deserve it, and yet make the Poor and others, &c. pay dear enough for Coals, both at Landon and elsewhere, when, in Truth, I think (would they but lye their groundless pretences by) they may or might afford them cheaper to the Poor, &c. now than when they gave 11 s. 6 d. or 12 s. per Chaldron at the Pits, or first Charge, besides Fittage, &c. but, Sir, I have observed something of the low Price of Coals for thele Moderate Purposes, that the poor Miners who do dayly venture their Lives (as perhaps I shall hereafter have occasion to speak of more at large) may have Wages to live on, to get Bread for their Families by their Labour, and that those Gentlemen who have the good Fortune of fuch Coal-Mines in their Grounds, may be encouraged to fet all Idle Hands to work, and prevent Increase of Beggars, and likewise may have a moderate Advantage by their Mines, whereas, I am affraid, those Owners who have their Mines up in the Country, and so have a long Carriage to the Water of their Coals, adventuring great Sums of Money in their Colleries, at the low Price Coals sell at now, cannot get much Profit, which indeed is to be Comiserated by all well meaning Persons, for it is but reasonable where much is expended, that some Benefit should arise to the Adventurer, especially when such an Adventure is so useful to

the Publick, in imploying and maintaining fo many Poor as this doth: may, if Incouragement (or Profit) were not allow'd to the Adventurers, what would those Persons do to live so well that have Lands wherein Colleries are, yet have not a Fund to work fuch Colleries, being so obliged to let their Colleries to some Adventurers who have Cash? but if no Profit can be raised, I see no Reason why any Man should Adventure his Money. But to proceed, Lastly, there is another Bed of Coal, which is about New-Caftle wrought yet not found on Sunderland River (as I know of) which is called the Stone-Coal, it is so called, because it has a fort of Stone, which is in the Bed or Vein of Coal; and about the middle of the Bed or Vein, yet it is accounted as good as the Main Coal, only it is Subject to be a little Slaty, as I am told, and which I think cannot well be remedy'd, for it is hard to pick all Stones out, when wrought with the Coal, let Persons be never so careful, and now having given you an Account of the several forts, names, and nature of these Northern Pit-Coals, I shall beg leave to give you a further account of Sinking these Coal-Pits. I am sensible you know when we fink a Pit, at first we break or cut the Ground four Square, and the Diameter of the Square is generally approved of to be, according to the Distick in Virgil.

> Die quibus in Terris, & eris mibi magnus Apollo, Tres pateat Cæli spatium non amplius ulnas.

Virgil Eglog. 3.

it

the

but

thr

De

fall if

qui

ha

fqu

Sai

the

fin

C1

in

W

(0

D

(b

th to

on

by

M

at

tl

th

E

fi

b

About 9 Quarters and he hit it right, if he accounted an Ell according to the Flemish or Dutch Ell, which (I am told) is 3 Quarters, then we carry on our Works with such Timber as before mentioned, and in the same 4 Square Form, till we come near to the Stone Head, where we form it into 8 Squares, the better to incline it to answer the Ring, or round Form of the Stone-Work, which is always to wrought or fashion'd; but we always wish not to meet with any Quick-Sand or too great a Feeder of Water, whilst working through this Earthy Part to the Stone Head, for some Quick-Sands have baulk'd our Winning the Pit, where we had begun so to Sinck, as

Top Feeders best carried off, by another half Shaft.

likewise some great Feeders of Water have done, therefore many times we are forced (in Case of the Water) to finck another Pit or Shaft to the stone, or lower shaft to have aWater-Course or Drift from the intended Coal-Shaft to this other Shaft, that the Water which rifes at the Coal-Shaft, may

run into this Water or half Shaft, to be drawn there by Hories or Water Wheels, as their is a conveniency for it, that so the Water may not follow or descend, with Sinking; which Method I think is esteemed best to carry off Feeders in the Earthy, or top Part of a Coal-Shaft, because if the Feeder be of any considerable Quantity,

Dur bam.

the Deals and Timber work, notwithstanding all that can be done; but Quick-Sands (if not too thick) are often put through by Deals or Timber, for we lay chook How to get Deals (as we call them) which is Deales put in as through Quick-fast, or all along, as we dig, the Sand, or Earth, that Sands. if possible we may keep the Sand by this extream quick Vigilancy and Care from getting in upon us, I At Harraton,

have heard of Iron Frames that have been us'd (made fquare and deeper, then the thickness of the Quick-

oth;

ven-

ands

rics,

who

why

ftly,

ight

lled

hich

Bed

t is

vell

ght

ven

ele

int

ka

lia-

to

d-

S,

d,

e.

ys

y

e

IS

t

Sand) to put back these Quick-Sands, which may be of good use, tho' they must be dear to be so Cast or Wrought; but I do not find but this way of Timbering is most used, only they put stiff Clay to the Inside of the Timber work, which is forc'd and ram'd in next the Sand, to keep it back from the Timber.

And now am I come to the Stone-Head, or Stone Work, where we are likely to meet with hard Work enough, perhaps the Sincker

(or Labourer) has, as before, 12 d. or 14 d. a

Day, yet it is not every Labourer who has been

(by chance) in a Coal Pit, or at Labour in o
ther fort of digging above Ground, that is fit

ployed.

to be imployed in this Work, but it should be one that understands the Nature of Stone and Styth, and Surfet. by some Experience had before in such fort of Labour, who for saving Moneys to the Owner, by imprudent managing, and breaking, and fpoiling his Tools, or finking Hacks (which we must have a Smith at Hand to be ready for sharpening, as the Points are broke off, which is still Chargeable and loss of time, or the Hacks wore off, with the constant Labour, can make no furtherance of Work, or does little; as also for his own Personal Security, for if he have not Judgment, the Shivers or Splints of the Whin or hard Stone, which is met with, will Wound him feverely (I have known it so) to the loss of their Eyes, and cutting their Leaders and Nerves, in Arms or Legs to their future Lameneis and Inability of Labour ever after: But what is work of all if he be altogether unacquainted with this fort of finking Labour, he may loofe his Life by Styth, which is a fort of bad foul Air, or Fume exhaling out of some Minerals, or partings of Stone (for there are several forts of Stone, which we pass thro' as well as Minerals, &c.) and here an Ignorant Man is Cheated of his Life infencibly, as also he by his Ignorance may be burnt to Death by the Surfet, which is another dangerous fort of badAir, but of a fiery Nature like Lightning, which blafts and tears all before it, if it takes hold of the Candle, which an experienced Labourer will discover and extinguish, tho' it be going to take at his Candle, and can sometimes smell to be Dangerous or hurtful, therefore all Sinkers should be skilled in these Matters for their own Security sake, as all o for the Benefit of the Owner or Master of the Collery, for if 1000 l.

C_W

like

rise

Us.

you

mai

TVC.

itb

it.

fon or l

ope

ber

of ma

in f

is p

wil

We

but

(or

the

YOU

(wl

bef

and

fon

and

or

fing

we

the

the

feet

faid

kno

in (

or more bespected, and then by an Ignorant Man should be blasted by a strong Blast, by Surfeit; so that it may (as has been known) tear up your Timber Work and shatter the Gins, and shake the Stone Work, or Frame Work, so as to let in Feeders of Water, besides the Destruction of the Persons in the Shaft, this would be a dismal Accident with a Witness, as well as loss of all the Labour and Cost by Ignorance.

Coal Owner.] But do you not meet with Springs or Feeders of Water in your finking, which I reckon as great Enemys to the

Prize and Concern, as those of Styth, Fire, and Whin?

Servant.] Yes, Sir, too often, and it is very rarely found, that a Pit of 40, 50, or 60 Fathom is lunk, without going through feveral forts of Feeders; indeed, were it not for Water, a Collery in these Parts, might be termed a Golden Mine to Purpose, for Dry Colleries would fave several Thousands per Ann. which is expended in drawing Water hereabouts, and I call them Feeders of Water rather then Springs, because, I have always observed, That the Water (which is the same in Taste, and as drinkable as what you call Fine Springs on the Surface of the Earth or above Ground, (which we so often cut through, and put back, or Cawke, like as a Ship or Veffel is Cawked on the Ocean or River) we by our Works find not to rife upwards or Perpendicularly, but to come in some parting of Stone, or Mineral, or otherwise, between or parting the Earth from the Stone, or else parting some kind of Earth from other fort of Earth, flanting or fideways; fo that we think it cannot be so well called a Spring, which doubtless some take to be, by Boiling always upwards, as if it came up through the whole Centre of the Earth; whereas (if rightly confidered in our Opinion) it is impossible that Water should Perpendicularly so Bubble or Boil up, through such a vast Body of Rocks and Minerals, and therefore as we often go through and below those Waters or Feeders; it is plain it cannot come Perpendicularly, for we leave it above our Heads in the Shaft, either framed and cawkt back, or else we by a Drift or Water-Course, (as before mentioned) draw it at that depth Besides, it is further plain and apand no lower, at another Shaft. parent to us, that there are several Partings or Partitions, with feveral Concavities, where out comes fomerimes Dry, Stinking, Sweet and Sulpherous Air, and fuch fort of Waters likewise, so that the Reason why Water Bubbles up, is, we think, because the Parting in which it had its Course is some how stop'd, and as it cannot descend through the mighty Body of Stone. it must of necessity rise through the spungy Earth, all which Water we suppose to come from the Sea, and so being fed by that inexhaustible Fountain, we call it by the Name of a Feeder. and that it may rife to the top of any Mountain or part of the Earth, we are subject to believe no great Matter of Wonder, because we are so often, by the Curious

Coal

by a

tear

one

ides

mal Coft

s of

the

it a

ve-

in

Dry

nd-

ter

he

ou

id,

sa

ks

t-

he m

n-

by

re

n)

oil

re

in

in

i

h

-

h

3

o

c

t

and Learned, told, That the Sea, this Fountain Head, is higher than the Earth; and it is a common thing to fee the like Performance, that any Water coming from the Fountain, will rife to the height of that Fountain Head, as in all Water Works Use in London and ellewhere

Coal Owner.] Well, you tell me of Framing and Cawking back your Feeders and of drawing up your Water, let me hear your mannear of framing, and drawing your Feeders in your Shafts.

Servant, For framing back our haft Feeders; How to frame we make use of Wood, but chiefly Fire, because back Water. it being a fost fort of, or spungy Wood, we think it fivells with the Water lying against it, and Wedges best by reafon of its yielding, Quality or Softness, so that the least Thread. or Leak of Water, which may proceed from the least Chicks, or openels of the Wood, are bell itop'd, and wedged back by Fire Time ber, yet requires Judgment, in the Head-Servant (or Over-Man) of the Sinkers, to give prudent Directions, how high or big to make this Frame, for by chance we may have a Feeder come in some small parting of Mettle or Stone, the Concavity whereof is not much more than half an Inch, yet having so much Liberty, will afford us a great deal of Water. Now if we were only to Wedge on Frame back that half Inch's Concavity, it is two to one (or both) that Cranny or half Inch Frame; which if, then will the Feeder certainly burst throw that soft Stone or Mettle, when as your Frame rightly order'd holds, or stands, so that your head Sinker. (whose, sole; Care above all things, must be to be always present at such Framing) should understand well what fort of Stone will hold back the Feeders with the Frame, and therefore before he puts in the Frame, he should know this aforesaid, and fo cut out such loft Stone or Mettle, and making his Frame, fo much bigger at first and Judicially, may save a second Trouble and Charge thereof.

But it must be further Observed, That as this Mettle, or Stone, or Coal, may be ruff, and cannot be cut up so extraordinary; finooth as to stop all Drainings of Water, then in such a Case we make use of Sheep-Skins, with the Wool on the Wool next; the rough Mettle, &c. which being well Wedged in between the Frame and such rough Mettle, Gr. the Wood we find to Perfeet our Design of stopping the Water: And Wool is generally faid to be of a very durable Quality; scarce ever to rot; I have known fuch Frames to have flop'd back whole Waists of Water.

in Collieries, and not doubted but to last to Purpole.

Drawing of Water.

And now as to Drawing of Water, we generally Draw, it by Tubs or Buckets; whilst Sinking with Jack Rowl, or by Mens

winding up the Rowl, or otherwise, if the Pit be Sunk more then thirty Fathom, then we use the Horse Engin, which Engine being wrought with one or two Horses at a time, as the Water requires, serves also, after we have Coaled the Pit, to draw up the Wrought Coals. Which Engin, tho' it be but of a plain Fashion, yet is found by Experience to be more servicable and expeditious, to draw both Water and Coal, then any other Engine we have feen in these Parts yet, notwithstanding we have had many pretenders, in many Kinds and Methods; though we would be glad any Ingenious Artist, could show us a better or more effectual way, for Expedition and Service, then we now use hereabouts. In some places we draw Water by Water, with Water-Wheels or long Axel-Trees, but there is not that Conveniency of Water every where, and as for Wind-Mills, or Ginns to go by Wind; 'tis fure the Wind blows not to purpose at all times, and therefore, whereas we cannot Sink Pits, but still will have fome Water to draw, and many times fo much as takes up all (or most of) the spare time we have from Coal-work; it follows we must have a Method whereby to draw this Water when we please, or at any time, or otherwise, we must continue this plain Method we now have, If it would be made Apparent, that as we have it noised Abroad, there is this and that Invention found out to draw out all great old Waists, or Drowned Collieries, of what depth foever; I dare affure fuch Artists, may have such Encouragement as would keep them their Coach and Six, for we cannot do it by our Engines, and there are feveral good Collieries which lye unwrought and drowned for want of fuch Noble Engines or Methods as are talk'd of or pretended to. yet there is one Invention of drawing Water by Fire, which we hear of, and perhaps doth to purpose in many Places and Circumstances, but in these Collieries here a way, I am affraid, there are not many dare Venture of it, because Nature doth generally offord us too much Sulpherous Matter, to bring more Fire within these our deep Bowels of the Earth, so that we Judge cool Inventions of Suction or Force, would be fafelt for this our Concern, if any fuch could be found that would do fo much better, and with more Expedition than what is done generally

And now having given you an Account of our Method of Sinking Shafts, both through the Earth and Stone and Feeders, when I come to the Signs of approaching, or being near the Coal, we generally have the Roof, (or what lies next to, or upon the Coal) of a foster kind of Stone or Mettle, of a blackish Colour, yet do not defire, for the Good of you our Masters, Coal Owners, to have this Roof too foft or tender, reither to have a Feeder next the Coal or too near it, in a too tender Roof, for Water spoils Coals in the Colliery for Sale, making them

blac

Ma

fore

load out

not

ten top

per by

dov

or :

and

to alre

you

3 6

Pit

afte No

my of t

Qu

befo

ing

1C 15

a 1

wh

hav

Ish

dor

Pic

hav

Tit

ing

lea

tak

Pit

is (

tho w C

an

black and heavy, which doth not relish well with the Ship-Mafter or first Buyer, because he buyes here by Weight, and therefore being heavy, a less quantity of those Wet and so heavy Coals loads him, then of dry bright Coals, which he finds in his making out in Sale at London and elsewhere, where he sells by Measure, and

not by Weight.

ore

En-

the

to

of a

and

her

ben

uld

ore

re-

er-

CY

ge

es,

Ve

or

WS

WC his

at

on

ol-

As.

ch

e-

of

0,

ve

r-

re

y

n'

d

r

h

y

n

And again, if the Roof, or Cover, of the Coal be too tender or foft, though dry, we must not take so much of the top of the Coale away, as when the Roof is strong, but leave perhaps about a Foot thick of the Coal top for a Roof, leaft by the foftness of the Mettle Roof, that Roof should fall down and kill your Miners, or what is also bad, bring a Thrust, or a general Crush in one of your Collieries to close it quite up. and thereby lose the Colliery; it is therefore of great Advantage to have a strong Roof or Cover of the Cost, because of what is already faid, and further, because (though it is but rarely so) you may take away, and use all the Coal to the Roof, which is a great Increase of your Quantities, wrought out of such Pits: but now being happily past all this Trouble and Charge, after the prescribed Methods, and having happily Coaled this Noble Main-Coal. My Business of a Sinker is at an end, only I mult give you an Account of the Thickness of the Bed, or Vein of this Coal, which (as before) may be about eight, or eight Quarteas and a half thick, and then laitly making a Sump, as before mentioned, I must take my leave of this Subject of Sinking, after you have been pleas'd to give your Sinkers (because it is customary) the Labourers, whom I have employed for you, a Piece or Guinea, to Drink the good Success of the Colliery, which is called their Coaling-Money, and then lye Idle till you have occasion to break, or begin to Sink another Pit, which I hope will not be long first, for it is judged to be a Point of Wisdom and Care, not be too long or tedious in providing a Pit or Pits, to be ready funk and ready to fet to Work against the time you have Wrought out your Coaled Working Pit; that so you lose no Time, or Charges of the Water-drawing, by Coal-Work, standing some time before you Coal another Pit. And now I must leave your to your Viewer, or Head Under-over Man, who is to take Charge of a Regular Working of the Colliery;

Coal Owner.] Well, honest Sinker, now thou hast Coaled the Pit, take thy Wages and the Labourers too, with what thou fayest is Customary to drink, and this Viewer, or this under over Man thou hast Recommended to me, I hope will give me an Account of what his Bufiness must be, and how he designs to go on with his Coal-Work, being, I perceive, you Sinckers differ in Judgment,

and Methods from hewing or working Coals,

Kiemeria Siran my Welghbour and Acquaintance having in ing Opin on, provided a very good dry and convenient shift; with your good Leavey I shall make bold to acquaint you of what is requifite to be done doll yours and my part, for there is fomething on both files to be done or provided; In the first Place, Sir, on your fide, you are to buy in a flock of able throng Horses out of lead ato draw your Coals to Bank for Day lout of the of Lineing, Pitt, and whereas by my Plumot-Line, which I Measure the depth of the Shalt by, as they line or found for the depth of a River, I find the Pit is about 60 Fathom, The Mount 21 Scores of Corves of Coals wrought, and 21 Scores drawn per Day, is a good Days work, and as much a Days Work as male Collieries of that depth, can, or do confrantly Work, which Bit will require at least eight. Horses every Day, to perform that Work, which is, as always Cultomary, 4 thifts of Hories, at two in at a time, and indeed you Grou'd have a spare Shift, on two Horses more ready, least a House or two, Tyfle, or be out of Order by a Fall, or any other Accidenti or Illness, and fai out of Condition to Work; for if you want is Shift on two of these eight Horses, you either loose a whole Days Wark of Goals, or at least that it is besides, your Workmen, or at leaft fome of them, will exped as much for their Days, Work, though it wan't a quarter of vits Quantity's forthat two Spare Hoffes, which for you know makes it up ten Horses is in my Opinion, for those Reasons above, rather more Convenient for you to buy for one Pit, and it will Ballance the Charge of maintaining a spare Shift pof off offers, in the said two Respects, both of Supplying a lamed on fick Horses places (whith would be defroyed by awork, when in fuch an ill-and unfit Condition, as alfor of making out your Days Work, and wages as aforefaid. Thefe ten Horfes muft at leaft in thefe Barts fland you in fix or feven Pounds a piece, or more the better ; I have known fomerdo not value to give ten or twelve Guineas a piece for young, frong and mettle Geldings or Mares; for by those Qualifications your may expactithein to last longer in this heavy Work, and old weak Horses (though cheap hought) are doon wrought out or spayl'd by fuch Labour; and medo not find Stone-Honfes fit for this use, because they are more unruly and singovernable, neither can see in their open. Countries conveniently turn them out in Summer time to Grais amongst themselves, for Geldings, least they lame or spoil one another, and it is very convenient to refresh these confrant hard working Horses in their Limbs, in Summer time, otherwise they are subject to Beat or Founder Two Sledge-Horfes. to their Feet or Loggs; we must have two more Horses of a less Value, bought to Sledge out with, or draw the Corves as they come out of the Pit, on a Sledge an both fides the Pit, of three or four Pounds a Piece,

.

or

yo th

the

be

for

in,

th

for

we

abo

Co

Ban

lon

the

Co

up,

fide

be?

Inc

tce

you

&c.

Or

or

or

affo

to

wh

all

Sco

pay

the

Wo

him

giv

Wic

or Aged wore out Coal-Horses, which after some time Wrought. you will have, may ferve turn for Sledge Horses; the same Ginthat your Sinkers used, will serve for Coal Work, and every thing thereto belonging: But a Cable of three Inches round and of good Stuff, will do better for Coal-Work, because it will be lighter for the Horfes, then this Sinking Rope or Cable of four Inches, or thereabouts.

And whereas I fpeak of Corves, or Baskets to put the Coals in, we must have a Man (which is called the Corver) to make thom.

of the or bridge gude, the right done, has an energy

my

ith

EIS

nc-

ice, ries

the

b.I

Qr. m.

ind ach.

ontht

ys: OULG

nfe

Acre

out

SA ME

or:

y 3

on

Me!

he:

NO

the

4

d

or

lo

g

y ık.

#

2,

ic:

er

IC! fe: 2, P

0

C

2

,

The Corves to be made of Hazle.

He must have a good Quantity of young Hazle Rods, provided for that Purpose, with young Plants, or Sippleings, as we here call them, of Oak, Ash or Aller, of about three Inches thick, or better, for the Corfi Bay. Corf-Bow; we boy the Rods by Bunch each Bonch, containing about a Hundred Rods, at about Six-pence

per Bunch, and the Bows being better then two Yards long, for half a Grown or three Shillings per Dozen, or and wandaras thereabouts your I have easy A. From work ou

Your Corver ought to be just to you, in keeping up your Corfe, for with Working the Coals, being drawn pretty briskly up, the Corves nates subject to Clash and beat against the Shaft fides, and so beats down your Corfe dayly, that if your Corves be not dayly beat up and mended; you may lose more then one Inch dayly, which would bring your Measure or Corfe, of fourteen or fifteen Pecks, down to nine or ten Pecks, and fo lofe you a third of your Meafure, and cost of Working or Hewing, &c. for it is most usual to agree with your Heners of Coals or Miners, by the Score of Corves, by chance for ten Pence or twelve Pence for teach Score, according to the tendernels or hardness of the Coal, or according to what the Mine will afford, and not by the Day, or Shift Work, for it is common to give about twelve Rence or fourteen Pence for each Shift, when perhaps you will not have above thinteen or fifteen Corves a Man per Shift; so that it is clearly best to agree by the Score, and then good Hand, good Hire, as we fay, and you pay, for no more then you have Wrought, or comes out of

It is the Over Man's Bufiness to place the Miners in their Workings, or Boards, or Headways; And every Hewer gives him an Account of what Quantity the will Work dayly, or give; so that he every Day taking the Account of the Work, finds what Number of Men will Compleat the intended Day's Work or Quantity.

Besides these Miners, called Hewers, there is another sort of Labourers which are called Barrow-Men, or Coal-Putters, these Persons take the hewed Coals from the Hewers, as they work them, or as fast as they can, and filling the Corves with these Wrought Coals, put or pull away the full Curves of Coals, which are set, when empty, upon a Sledge of Wood, and so halled all along the Barrow-way to the Pit-Shast by two or three Persons, one before and the other behind the Corse, where they hook it by the Cors-Bow to the Cable, which, with the Horses is drawn up to the top, or to Day, as it is their Phrase, where the Banck's-Man, or he that guides the Sledge-Horse, has an empty Sledge to set the Loaden Corse on, as he takes it out of the Hook on the Pit-Rope, and then immediately hooking on an empty Corse, he leads his Stead-Horse away with the Loaden Corse, to what Place of the Coal heap he pleases.

One of these two Men that guides the Sledge-Horses, on the Banck or Surface of the Earth, is called the Over-Man of the Tree, or chief Banck's-Man, for he takes an Account of the Quantity of loaden Corves of Coals, which come to the Bank or out of the Pit every Day, by Sticks or Peices of Wood, which is put in by the last Barrow-Man of the Number which is under Ground, so that if his Memory fails him, those Sticks immediately show him how many Rounds the Barrow Men have put, and so what quantity of Scores are Wrought: And if there chance to be any Hewers, who do not Hew their full quantity, they give first an Account of it to the Under-Over-Man,

as before mentioned.

Then the Work falling fhort of the set Day's Work of twenty or twenty one Scores, that Abatement is taken Notice of by the Banck's-Man, and is made good another time, or else at the general Pay, (being Noted by the Clarks of the Works, to whom the Banck's-Man dayly gives an Account of the quantity Wrought) it is abated on these Persons that made the Abatement, that so the Coal-Owner may not pay for more Coals than he had.

And further, there is strict Notice taken dayly by the said Bancks-Men, if Honest, of the filling of the Corves with Coals, for otherwise both the Hewers, and Barrow-Men, will confederate under Ground, and if the Coals be Hewed or Wrought pretty Round and Large Coals, they will be sometimes so Roguish, as

Fraud. tom, and cover them with some small Coals at the top of the Corves, and make it look like a full Corfe, which Fraud when discover'd by the Banck's-Man, and the Coals shaken in close appears to be listle more then a half Corfe, is Noted by the sancks-Men, who do not empty that salse Corfe, but setting it by as it is, when shaken in, lets

has for filling Peneral T

it f

frot

oth

that

Off

Cor

the

Peneto for the begins of the b

you happ of the to puthen these Tran

for

look a rii it is Owi

rally for a it stand on the Coal-heap, till the Offender comes to Banck or from under Ground, and there is Reprimanded Publickly before others, and the forfeiture is to give another full Corfe, with that bad filled one for it, or otherwise at the general Pay the Offender Forfeits six Pence per Corfe, for every such bad filled Corfe to the Owner, which is Deducted out of his Wages by the Steward or Pay-Master.

So that the Over-Man of the Tree, or Chief Banck's-Man, has two Pence for each Day more then the other Bancks-Man, for taking Care of the Quantity Wrought, and of the bad filling of the Corves, the Common Wages is about fixteen Pence a Day for the Over-Man of the Tree, and fourteen

Pence a Day for the other Banck's-Man, or Sledder.

of

ele

ork

cle

als,

fo

100

fes

ere

ok ok

ty

fe,

he

he

he

he

d,

ch

ks

ve

if

n-

m,

ty

oy at

to

y_

t,o

id

150

te

y

25

t-

11

y

ts

i

The Wages for the Barrow-Men is usually about twenty Pence, or two and twenty Pence a Day for each Tram (that is to fay) for putting so many loaden Corves, as are carried on one Sledge, or Tram in one Day to the Pit-Shaft, at the first beginning of Coal Work in a new Pit, it is usual to begin with fix Trams, which put and hook to the Cable three Score and ten Curves a Piece every Day, which makes up twenty one Scores a Day, and then about every thirtieth Day, or so, afterwards, they have a Barrow-Man, or Tram added, still at the same Wages of twenty Pence, or two and twenty Pence per Day, till by chance the Coal will be fo far Wrought under Ground, that there must be sixteen Trams; which brings it fo, from seventy Corves put, to about twenty six Corves a Tram, so that the more and further a Pit is Wrought, you see for they still keep up the first Price of a Day's Work, were you to add never so many Trams; nay sometimes a Pit may happen to have a Hitch or Dipping of the Thill or Bottom of the way, by which such Setling or Descent, you are sensible to pull a full Corfe, up such a sort of a rise requires more Strength, then where it is drawn down Banck, why then in fuch a Case these Barrow-Men will rise their Wages two Pence a Day for each Tram, or more according as the Hitch is, therefore it is always look'd upon to be of good Advantage to the Colliery, to have a rise in the Thill, and of the Coal, as we work, because it is easier in putting, and so consequently Cheaper to the Owner.

Why the Rife is.

Here I cannot but take Notice by the by, of what we generally have in all Collieries, and that is, there is a Rife, or Afficent, for a Colliery under Ground, and so by Consequence the con-

Hil

fa

da fo

Pe

int

m

an

the

W

kir

Sol

to

and

He

Bo

Co

we

ent

one

to :

Seo

oth

tage

the

WC

till

wit

have

the

is ti

Ne

and

on i

The

I ha

or g

Mai

for

abou

the

leaf

B

trary way, a Dip or Settling for a Gurrent; this said Rise is commonly found to be to the South, and to the South West of most Collieries. We can give no Reason why this should be so, only I have with my self Fancied it may be (by a Magnetic sott of Quality) with Respect to the Sun's Noted Ascent to the said South Points, and I call it Magnetic, not in Respect of the Magnet or Load-Stone, because that draws to North Point but Magnetic, quod magnas babet Vires. Or otherwise by bearing some Proportion with the Nature of the Descent and Current of the Waters, or Rivers in this Kingdom, which are generally Observed to be to the Eastwards: but I shall wave this piece of Curiofity, it being above my Capacity, and shall proceed to give some Account of what is a Viewers Office and Duty, and how he

ought to be qualified for fuch an Imploy.

And First, this fort of Servant (as in all other Cases) ought to be well skill'd in this great Concern he takes in his Hand, he ought to know Lineing and Levelling well, as also the Method of Coal-Working, together with the Knowledge of the Nature of the Coal; for there is very great Occasion for all these four Qualifications, as follows in the Sequel, he should know how to Line well, because he must set out his first Work or Headways, according to Rule by the Compass, (which is as useful under Ground to know which way and how far he goes, as it is in Sailing) nay, being more in the dark (because so deep in the Earth) it is impossible to know how we go under Ground, or at least so exactly as requisite, unless we have our Compass, and so Line by it, to any Point thereof, which we by the Scituation, of our Ground and Colliery are obliged to Work to, for that by the Compais feeing how the Hadways lies (which alters pretty much in some Collieries perhaps more to the South-West or South East, for the South Headways) then in others, this Headways, I fay, or first working (which is generally Wrought by the Yard, whether it be Single or Double) is carried on, according to the Grain of the Coal, as it lies along the Grain, and not cross the Grain, neither is it Wrought so wide, as the other Works or Boards are; a Yard and Quarter broad or wide for a Headways is full fufficient, and out of this it is, we turn off the Boards or other Workings, for every particular Hewer, or Mirer, and that Board or Work-place for that one Man, is generally about three Yards, or better, in breadth, and fo from the Headways, which we will fay runs South, we work the Boards East and West of the Headways, not taking all the Coal away as we go, for then we would bring a Thruit of the Collery upon us: But after we have carried our Head-ways Drift, about eight or ten Yards from the Pit Shaft, then we confider of a Winning, how much to allow for a Winning, which is about feven Yards in these parts, or otherwise, according to the Quam-

nost

nly of

aid

ag-

me

the.

Db-

id-

nie.

he

ght

he

od

ure

to

ys,

der

ail-

the

at

lo

ion,

ers

/eft

this

ght

ac-

her

for,

off

or

ne-

om

the

oal

ol-

rift,

rot

out ua-

tyj

fafest and best; out of this Winning of 7 Yards, perhaps we dare not venture to take above three Yards breadth of Coal for a Board; so that then there is but three Yards for one Man to work by himself, and therefore would be Dangerous for two Persons to Work together, least they should strike their Coal-Pits into one another, or at least hinder one another; then the Remainder of four Yards is left for a Pillar to support the Roof and Weight of the Barth above; which makes it out so, that there is not quite half of the Goals taken out of the Ground which lies there.

And in this Method it is that we carry on this Coal Work, taking away three Yards or better, according to the Strength or Softness of the Coal, and leaving four Yards standing for Pillars to support, as before, so that reckoning seven Yards to a Winning, and to have twenty Boards, we must of Course drive our South Headways 150 Yards in Length, or thereabouts, to have all the Boards of one fide of the Headways: And therefore in a working Colliery, it is best to win out the Headways first, so far, as that we can clap a whole Set of Hewers in to Wine for the Boards, at first entring into a New Pit, for then we keep the Work going all on one fide, and when that fide is Wrought out, we begin de Novo to work on the other fac, the same Headways serving us again as before, and besides we bring our Barrow-Men to put three Score and ten Corves a Day per Tram, as we did at first on the other fide of the Headways; which is to the Owners Advan-tage; and after this South Headways is thus Wrought out to the East and West Hand of it; then it follows to turn the Workings to the North Headways, or other fide of the Shaft, which we go on with after the same Method, as in the South, till we have wrought by these same Rules, all the Coal we can, with fafety venture to Work or take away; and so by chance have Wrought, or waifted the Colliery 8 Score or 200 Yards to the East, West, North and South of the Pit-Shaft, and then it is time to have another Shaft at that Distance sunk for another New Pit, which if happily done by the dayly Care, Prudence, and Orders of the Viewer, and his Drift to the New Pit, carried on exactly so as to hit the New Shaft, and supply her with Air. Then has he evidenc'd both his Care and Parts in the Respects I have mention'd, and well deserved his 15 s. or 20 s. per Week, or more, as he has Pits to look after; and he has an Under-Over-Man, always allowed for every Pit, whilst one Viewer serves for three or four Working Pits, and the Over-Man's wages is about 8 s. a Week.

But now I would give you an Account, that for the safety of the Miners, we must be careful of guiding the Air under Ground, least we bring a Styth, or a Blast, by the Sulpher or Surfeit, upon

the poor Men, as of late it did, not far from New-Caftle, I think it was but in Ochober 1705, that I was told by About the 3d one who was acquainted with, and fee some of the Dead buried, and had been at the Pits after or 4th Day. the Blaff, that there was above thirty Person Young and Old slain by a Blast, perhaps in less than a Minutes How it came to pass he could not give me an exact Ac count, any further then by what the Banck's-Men, and those who were about the Pit, and heard the blow, and fee what it threw out of the Pit, and shatter'd about the Gins: There was on thing very Strange in it, as I was told, That a Youth of 15 or 16 Years of Age, was blown up out of the Pit and Shaft, and carried by the Blast about 40 Yards from the Shaft, the Corp. was found all intire, fave the back part of his Head, which was cut off, though the Shaft is faid to be odd of fixty Fathom deep which is an Argument of the mighty Force this Blast is of; but those O er-Men or fuch, who should have given an Account where and how it first took, were all Slain; yet this is known by woful Experience, and which I my felf have seen and narrowly (by good Providecce,) escaped that some Collieries are very subject to this fatal Surfeit, and therefore it behoves the Viewers and Over-Men to be experienc'd in guiding the Air to good Purpose, a also to Order well and Prudently for Styth. which I before spoke of, doth Destroy the Ignorant and Unwary.

And thus it is plain, that both the Officers and poor Miners, are in dayly Peril and Hazard of their Lives, for a poor Livelyhood and that they may be easily Destroyed by Ignorant and Unskilful Managers, from which sudden and sad Missfortunes, I heartly Pray, Libera nos Domine: I have (as before spoke of) observed that their Workings or Boards are carryed by single Persons a pretty long way under Ground, yet they frequently hole, or cut through from one Board to another, to carry their Air forwards with their Works, and to the end or Face of their Boards or otherwise, the Air and Communication of it would not be good and safe to Work, but this Care of the Air must be taken in general, That it be not too much Dispersed, or too much Liberty given for want of Stoppings to spread it self from the particular Workings we are in Hand with, for the brisker it ranges in the

Works, the sweeter and safer it is for the Miners.

Coal-Owner.] But, Friend, can you give me now any good Account of the Nature of the Vend of Coals, as well as of the

Working them.

Servant.] Yes, Sir, I had some Experience in that, not long since; and shall therefore give you the best information I can it, especially on the River Were or Sanderland River, where observed. That, first, you must have a good stock of Coals provided against the time of Sale, which is chiefly in Summer by

Reafor

Re

Sail

goo

Ind

tw

of

hap

to

affo Co

of

the

Idl

rer

cuff

the

wh

the

old

Pro

sha

buy

in,

get

or I

mu

not

tim

que

Ex

Par

you

afo

Bri

dor

you

the

tho

this

for

the

(w)

Ste

and

Reason of the Weather, which makes it hazardous for Ships to Sail in Winter on those Coasts, for which Reason, I have heard good Saylers fay, they had rather run the Hazard of an East-India Voyage, then be obliged to fail all the Winter between London and New-Castle, whither it is not common for the Men of War to be out Convoy all the Winter, on those Coasts, per-

haps for the same Reasons.

Chink old by

ome of

ts after Person

linutes

et Ac

fe who threw

as one

or 16 t, and

Corp ch was

deep,

; but

count

nown rowly

y fub rs and fe, a

fpok

iners hood

kilfu

artily erved

rions

e, or for

pards

t be

en in

berty

cula

n the

good fth

tons

n o

ere

pro

by

afor

And though for such a Stock of Coals, it be at first considerable to Disburse, if it be but two or three Thousand Pounds, yet it will afford you good Interest for it, in two Respects, first you get your Coals cheaper Wrought in Winter time, then in Summer, or time of Trade, because Labourers or Miners are then more Numerous thereabouts, being Land-Sale Collieries are most commonly laid Idle for that Season of 111 Weather, and rather than those Labourers will lye Idle, they are prevailed on generally, and as it is customary to lower their Wages during the Winter Season; and then, Secondly, by having a good Stock aforehand, you have wherewith to Answer Demand, in time of Vend, so that thereby your Return is greater and doubtless (according to the old Maxim) the greater your Return is, the greater will your Profit be; for how, if I have a Shop, and have no Goods in it, shall I furnish the Demand of my Customers, when they come to buy of me, they will fay they cannot stay till I get them bought in, or made: and furely Ships can as ill lose time, or tarry till you get a Stock of Coals Wrought, because it is at no time Prudence, or proper to lose any part of the trading Season, but surely it is much more imprudent to lose time, when for safety the Ships dare not Trade without Convoy in this War time: So that to lofe time then, is to lose the Opportunity of Convoy, and by consequence to loose Trade, which I know to be too true by woful Experience in my late Business, and therefore, I hope you will Pardon this Advice from your Servant, being he does it to forwarn you of the Mischief and Damage, of want of a good Stock laid in aforehand, and I hope you will not be so unreasonable as to think, Brick can be made without Straw, or blame us, as others have done, because you will not provide for, or get a Trade, when you might thus secure it, and certainly it is the Master, and not the Servant, that should advance Moneys for a Stock or Trade, which can never be had, without you make such Provision for it, though it be the best Colliery in the whole World; but to add this is needless to any Gentleman of common Sence; therefore I shall proceed to my next, that an Interest is to be made in the Fitters, or those Persons who live at the Ports and have Keels, (which are much like to Lighters Built) to load the Ships, for the Rivers are not Navigable for Ships, so high as the Keys or Coal-Steaths, therefore these Keels are built flat Bottom'd for the purpose, and carry the Coals on Board; these said Fitters you are, I say, to

have an Interest in, for they are best acquainted with the Ship-Masters, and many times, nay generally have parts in the Shiping, so that to be sure where they Adventure their Moneys in a Ship, there they, in Reason, expect to have the Benest of Loading them as oft as they can, and so it is that Fitters have great Interest in loading the Vessels, and by consequence can best and what Coal-Owners they please in the Vend of Coals; and of late I fear it is, that they knowing their Interest and Power, make some Advantage (especially of new Collieries) to bring Trade to beginners; their pretence is to have and get no more then two Shillings and six Pence per Chaldron of the Master for Fittidge, which because a Keel carries no more than seven Chaldron a piece, at Sunderland,

is but seventeen Shillings and fix Pence per Keel, Keel-Men. for the rest of what they have of the Master of the

Vessel, is given to the Labourers that work the Keel, but (as before) for Encouragement of Trade, I am afraid you must abate six Pence per Chaldron of the pretended current Price privately, either by doing as it is said, some Persons have formerly done, that is, by ordering your Steward to return the six Pence per Chaldron, when the Fitter pays him, and so may say, as they did, you don't do it, because the Servant did it by private Orders, which the kind Fitter will keep so close and secret, that he would not Devulge it, though he give broad Signs of it to another Owner, when he complains of want of Trade with him, but yet for fear it should create open War amongst the Owners, he for his own Interest, will not publickly declare he has such an Abatement from such and such a kind Owner, of which Number, if you can by such a Method get to be one, then may you reasonably expect a Vend, and the Fitters Favour, because it is his Interest.

From hence it is that one great Colliery on the Wear, is thought to get so much of the Fitters Favour, and (Trade, much good may it do at the Current Noble Price Coals go at there now;) but I have heard some say, which seems more reasonable, they would desire but a reasonable Living-Price for Coals, and have all to be Just to such an Established Current Price, that so the Owners of Vessels, may not run away with all the Prosit, whilst the Consumers, and especially the Poor and the Coal-Owners get nothing by it; and this puts me now in mind of an Act of Parliament which was in Force, and Observed, for Admeasuring those Keels spoken of already, which I am told was design'd for a just Gauge or Measure, which should Oblige all Persons to be Content with, but whether the said Act did oblige Owners not to give any more,

I cannot hear yet.

However it is a great Complaint that there are everal Keels which work on that River Wear (if not on Tyne) which are not Admeasured according to that Act, and that the Persons that did formerly look so well, after such Admeasurement, have not of

ate

13

m

C

po

ge

de

O

Tho

Set

do

Liv

bef

bou

bet

hav

nea

Na

for

hav

hea

tha

yet for

into or (

tvai

of

rop

s n Hor

ther

oft,

be c

as t

will

and

ingt

Con

ixty

uch

late done it as ought to be, and all is for want of such Admeasurement as the Act required, but indeed I have never heard of any Complaint of this, either by Master or Owner of Vessels, I suppose it is because neither of them care how much Measure they get, nor how low the Price of Coals be there, so they be but dear enough at Bondon, or where they are sold again.

But, Sir, in time you will best Judge of this Matter, after you see what Profit your Colliery gives you, I would think some Owners have already had more Reason then my self to speak and stir more in it, for the Motive I have is my desire my Masters should live, which would be Encouragement to them to pay us Servants more Chearfully, for I have sound that where Profit doth not arise there Wages are paid, (though we venture our

Lives never fo much) but very Grudgingly, if at all.

hip-

ing,

hip,

ding

oal-

t is,

van-

and

aufe

and.

Leel,

the Ceel,

you

Price

erly

they

ders,

ould

mer,

fear

own

from

n by

ect a

, is

nuch

(; wo

they

e all

ners

the

t no-

ment

Ceels

ge or

vith,

ore,

Keels

t did

it of

late

But there is one thing more I would willingly take Notice of before my Conclusion, and that is the ill Condition of the Harbour of Sunderland, it is Confess'd that they have as good, or better Coals on that River, then on Tyne, and so doubtless might have as good a Vend, or better then New-Castle, because it is nearer to London than New-Caffle, and because of the Commodity. Nay, farther, because there is better Measure allowed they say, for at Sunderland they pay but for seven Chaldrons, when they have actually eight Chaldrons, whereas at New-Caftle I have heard them say, if eight be on Board the Keel, they are paid for that eight, and so do not give eight for seven, as at Sunderland; yet for all this, New-Castle gets the Majority of Vend by much, for if any Storm arises at Sea, there is no fafety in offering to go into Sunderland, there wants a Peor, as at Whitby, and Burlington, or elfewhere, befides the Bar is fo choaked up, that there is great want of Water; fo that were there something built for Security of Shipping, and cleansing the Haven there, it would bring doubtless much more Trade to it, then it now has, and there s no fear but were this Recommended to the Consideration of our Honourable Redressors, they would take effectual Care of it, for thereby both Ships and Lives would be faved, which are too often oft, for want of fuch Safe-Guard, and indeed, why should not the Coal-Owners and Fitters (who are Interested by Coal-Trade) be obliged to contribute towards to useful and necessary a Work as this is; and furely one need not fear but the Masters of Vessels will be as ready for their Lives and Interest Sake, as any body, and be likewise as free to pay for their Safety there, as in Burington, or any place elfe.

I have heard that the Annual Vend of Coass at Sunderland, is Computed at about fixty Thousand Chaldrons, if the said but fixty Thousand Chaldrons were to pay four Pence per Chaldron, to would raise a Thousand Pound per Annum, whereas it may by such amendment and safety of the Harbour night double the Trade,

yet this Thousand only per Annum would do the Business I am told, as also with what other Additions and Allowances of Tunnige for other Wares and Merchandize as are paid at the Ports aforesaid.

The said four Pence per Chaldron might be raised thus, and I am apt to think no body would contradict it, viz. the Coal-Owners to pay two Pence per Chaldron, the Fitters one Penny per Chaldron, and the Masters of Vessels loading in that Port, one Penny per Chaldron, which doth the Work.

Object. Ay, but what will New-Castle say to this? we know they will say it will prejudice their Trade, and therefore they must

be against it with Might and Main.

Answ. Why truly, I see no Reason, but one Part of the Kingdom may and ought to be encouraged as much as another, and that the Adventurers and Poor thereabouts should expect Trade and a Livelyhood, as well as at New-Castle; and besides, this is but for one Branch of Business, namely, Coals; but surely again if it be the Preservation of so much Shiping, and safety of many Lives. No Christian Man would be against such a good Act, for then we should not hear of the Complaints of so many poor Widows and poor Fatherless as we do thereabouts; and what Wrecks have been seen near Sunderland, or about a place called Souter between Sunderland and New-Castle, those Northern Parts can Witness, whereas had there been Provision of Safety made in that Port, those Missortunes or Losses had been prevented.

The Conclusion.

Thus, Sir, have I run over this small Piece with Brevity, and as plainly as I could, in hopes some other able Pen will give it some Lustre and to the best Advantage, it being not of the least Moment, and now I must remind you of the Custom of these Miners, that as soon as the Coal-Pits are Coaled, and Coal-Work begun, these Miners, expect something to Drink, which is sometimes 5 or 10 Guinea or more according to the Generosity of the Owners.

Pecunia Obediunt Omnia.

FINIS.

